




VMT100-40-M16-55-Z

Ruland VMT100-40-M16-55-Z, Rubber Bumper, 100mm OD, M16 Tapped Hole, 16mm Tapped Hole Depth, 40mm Height, 55 Shore A Natural Rubber Jacket, Steel

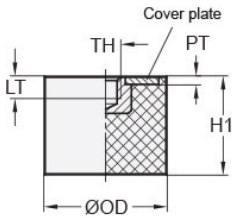


Description

Ruland VMT100-40-M16-55-Z is a rubber bumper with a tapped hole. It has a 100mm outside diameter, M16 tapped hole, 16mm tapped hole depth, and 40mm height. This rubber bumper is used to dampen shock loads and reduce noise and wear on industrial equipment, machine doors, and floors or other surfaces which allows for a safer and more pleasant working environment. It is often referred to as a sandwich mount or rubber buffer because it functions as shock or vibration isolator sandwiched between two machine components or surfaces. VMT100-40-M16-55-Z has a cylindrical shape allowing for even distribution of shock loads. It can be mounted to the system by threading it onto an existing stud on the components. The rubber jacket is made from natural rubber which has good elasticity. VMT100-40-M16-55-Z has 55 Shore A hardness for a balance of rigidity and shock absorption. The zinc plated steel body allows for high strength and is suitable for most industrial applications. It is manufactured by Otto Ganter, inventoried by Ruland, and RoHS3 compliant.

Product Specifications

Outer Diameter (OD)	3.94 in (100 mm)	Height (H1)	1.57 in (40 mm)
Thread (TH)	M16 x 2.0	Plate Thickness (PT)	0.12 in (3 mm)
Tapped Hole Depth (LT)	0.63 in (16.1 mm)	Spring Rate	6909.28 lb/in (1210 N/mm)
Shore Hardness	55A (+/- 5)	Max Deflection	0.40 in (10.2 mm)
Max Axial Load	2722.44 lb (12110 N)	Geometry	Cylindrical
Rubber Material	Natural Rubber	Metal Material	Zinc Plated Steel
Metallic Body Finish	Zinc-Plated	Manufacturer	JW Winco/ Otto Ganter
Country of Origin	Hungary	Weight (lbs)	1.133200
UPC	634529233672	Tariff Code	4016.99.6000
UNSPC	31162804		

Note 1 Performance ratings are for guidance only. The user must determine suitability for a particular application.

Prop 65  **WARNING** This product can expose you to the chemical Soots, known to the State of California to cause cancer. For more information go to www.P65Warnings.ca.gov.