
Hand Crimp Tool



Application Tooling Specification Sheet

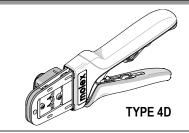

Order No. 63819-1300

FEATURES

- A full cycle ratcheting hand tool ensures complete crimps
- Ergonomic soft grip handles for comfortable crimping
- A precision user-friendly terminal locator wire stop holds terminals in the proper crimping position
- Right and Left handed applications
- Dies and Locator from this tool can be used in the Battery Powered Tool Order No.63816-0200 (110 V) or 63816-0250 (220 V), with the use of the 63816-0800 Crimp Head
- Many different tool kits can be used with a single Battery Powered Crimp Tool
- This tool is RoHS compliant, however RoHS compliant is not required


SCOPE

Products: 1.57mm (.062") Diameter, Standard .062" Pin and Socket Crimp Terminals, 18-24 AWG.

Terminal	Terminal Order No.					Size	Insulation Diameter		Strip Length	
Series No.	Loose	Piece	*	Reel	AWG	mm²	mm	ln.	mm	ln.
	02-06-2103	02-06-6119	02-06-2101	02-06-6118	18-24	N/A	1.52-3.05	.060120	2.41-3.04	.095120
	02-06-6102	04-01-0805	02-06-6100	39-00-0278						
1560	02-06-6103	39-00-0327	02-06-6101	39-00-0328						
	02-06-6104	39-00-0330	02-06-6105	39-00-0329						
	02-06-6112		02-06-6116							
	02-06-1103	04-01-0808	02-06-1101	04-01-0806	18-24			.060120	2.41-3.04	.095120
	02-06-5102	39-00-0331	02-06-1118	39-00-0279						
1561	02-06-5103	39-00-0334	02-06-5100	39-00-0332		N/A	1.52-3.05			
	02-06-5104		02-06-5101	39-00-0333						
	02-06-5109		02-06-5108							
1786	02-06-2202	02-06-6202	02-06-2201	02-06-6201	18-24	N/A	1.52-3.05	.060120	2.41-3.04	.095120
1707	02-06-1202		02-06-1201	02-06-5205	18-24	N/A	1.52-3.05	.060120	2.41-3.04	.095120
1787			02-06-5201		10-24					
5005	08-70-0042	08-70-1012	08-70-0001	08-70-1011	18-24	N/A	1.30-3.00	.051118	2.30-2.95	.090116
5006	08-70-0043	08-70-1014	08-70-0002	08-70-1013	18-24	N/A	1.30-3.00	.051118	2.30-2.95	.090116
★ Customer to cut off terminal from reel: 0.13mm (.005") maximum Cut-off Tab.										

Doc No: ATS-638191300 **UNCONTROLLED COPY** Release Date: 01-22-08 Revision: G Revision Date: 05-05-16

Page 1 of 9

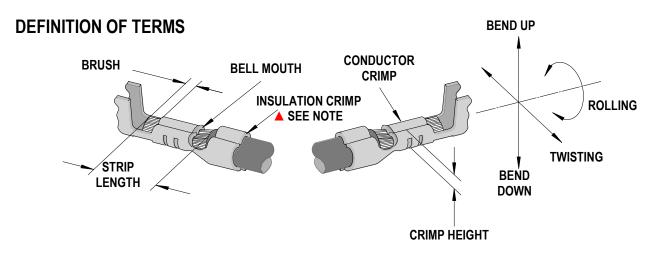

The above terminal drawing is a generic terminal representation. It is not an image of a terminal listed in the scope.

Tool Qualification Notes:

- 1. Pull Force should be measured with no influence from the insulation crimp.
- 2. The above specifications are guidelines to an optimum crimp.

CRIMP SPECIFICATIONS

After crimping, the crimped terminals should measure as follows:

Terminal	Wire Size		C	Insulation Crimp						
Series No			Height (Ref.)		Width (Ref.)		Height (Ref.)		Width (Ref.)	
Series NO	AWG	mm ²	mm	ln.	mm	ln.	mm	ln.	mm	ln.
1560	18	N/A	0.87-0.97	.034038	1.66	.065	2.62	.103	2.47	.097
	20		0.85-0.95	.033037	1.65	.065	2.60	.102	2.46	.096
	22		0.82-0.92	.032036	1.50	.059	2.20	.087	2.23	.088
	24		0.77-0.87	.030034	1.50	.059	2.12	.083	2.20	.087
	18		0.87-0.97	.034038	1.66	.065	2.62	.103	2.47	.097
1561	20	N/A	0.85-0.95	.033037	1.65	.065	2.60	.102	2.46	.096
1301	22	IN/A	0.82-0.92	.032036	1.50	.059	2.20	.087	2.23	.088
	24		0.77-0.87	.030034	1.50	.059	2.12	.083	2.20	.087
	18	N/A	0.87-0.97	.034038	1.66	.065	2.62	.103	2.47	.097
1786	20		0.85-0.95	.033037	1.65	.065	2.60	.102	2.46	.096
1700	22		0.82-0.92	.032036	1.50	.059	2.20	.087	2.23	.088
	24		0.77-0.87	.030034	1.50	.059	2.12	.083	2.20	.087
	18	N/A	0.87-0.97	.034038	1.66	.065	2.62	.103	2.47	.097
1787	20		0.85-0.95	.033037	1.65	.065	2.60	.102	2.46	.096
1707	22		0.82-0.92	.032036	1.50	.059	2.20	.087	2.23	.088
	24		0.77-0.87	.030034	1.50	.059	2.12	.083	2.20	.087
	18	N/A	0.94-1.04	.037041	1.68	.066	2.65	.104	2.54	1.00
5005	20		0.91-1.01	.036040	1.67	.065	2.58	.102	2.48	.098
3003	22		0.86-0.96	.034038	1.53	.060	2.27	.089	2.29	.090
	24		0.84-0.94	.033037	1.52	.059	2.20	.079	2.22	.087
	18	N/A	0.94-1.04	.037041	1.68	.066	2.65	.104	2.54	1.00
5006	20		0.91-1.01	.036040	1.67	.065	2.58	.102	2.48	.098
5000	22		0.86-0.96	.034038	1.53	.060	2.27	.089	2.29	.090
	24		0.84-0.94	.033037	1.52	.059	2.20	.079	2.22	.087

UNCONTROLLED COPY Page 2 of 9 Doc No: ATS-638191300 Release Date: 01-22-08 Revision Date: 05-05-16

Revision: G

Note:

The crimp height chart is provided with this document as <u>Reference Only.</u> Due to the wide range of wires, strands, insulation diameters, and insulation hardness, actual crimp height measurements may very slightly. An occasional, destructive, pull force test should be performed to check crimp integrity. Pull Force measurement <u>must</u> exceed the minimum pull force specification.


Terminal Series No	Wire Size		Pull Force	Profile		
Terminal Series No	AWG	mm ²	N	Lb.	18-20	22-24
	18	0.82	89	20	Х	
1560	20	0.52	66.8	15	Х	
1300	22	0.32	44.5	10		Χ
	24	0.20	35.6	8		Χ
	18	0.82	89	20	Χ	
1561	20	0.52	66.8	15	Χ	
1301	22	0.32	44.5	10		Χ
	24	0.20	35.6	8		Χ
	18	0.82	89	20	Χ	
1786	20	0.52	66.8	15	Χ	
1700	22	0.32	44.5	10		Χ
	24	0.20	35.6	8		Χ
	18	0.82	89	20	Х	
1787	20	0.52	66.8	15	Х	
1707	22	0.32	44.5	10		Χ
	24	0.20	35.6	8		Χ
	18	0.82	98	22	Х	
5005	20	0.52	66.8	15	Х	
5005	22	0.32	53.4	12		Χ
	24	0.20	35.6	8		Χ
_	18	0.82	98	22	Х	
5006	20	0.52	66.8	15	Х	
5006	22	0.32	53.4	12		Χ
	24	0.20	35.6	8		Χ

Tool Qualification Notes:

- 1. Pull Force should be measured with no influence from the insulation crimp.
- 2. The above specifications are guidelines to an optimum crimp.

▲ Insulation Crimp Note:

Due to the terminal's insulation grip design and/or insulation diameter range, this tool uses "overlap" form geometry in the insulation punch. This produces an overlap insulation crimp. While the insulation punch profile may appear "lopsided", this is a normal condition for this tool. See figure below.

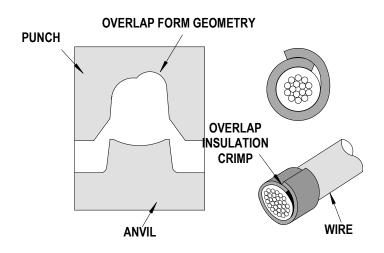

Doc No: ATS-638191300 Release Date: 01-22-08 **UNCONTROLLED COPY** Page 3 of 9 Revision: G Revision Date: 05-05-16

Insulation Crimp Quality

Crimping small insulation diameter wire in the 22-24AWG profile may cause a buckled insulation crimp. This is because the smaller insulation does not provide enough support to prevent the insulation grips from buckling while they are trying to overlap form.

The buckled insulation crimp can be prevented by using a larger insulation diameter wire. For example, the insulation crimps shown below are on a 24AWG wire. The UL1007 insulation does not provide enough support and the insulation grips buckle. The larger UL1015 insulation provides better grip support and the grips overlap.





In general, buckling can be prevented in the 22-24AWG profile by using an insulation diameter that is at least 1.6mm (0.063 in).

If small insulation diameter must be used, insulation grip buckling is acceptable provided that the insulation crimp does not damage the wire's conductor and the crimped terminal fits into the connector housing.

OPERATION



CAUTION: Crimp only the Molex terminals listed in the scope for this tool. Do not crimp hardened objects as damage can occur to the tool frame and/or crimp dies.

Open the tool by squeezing the handles together. At the end of the closing stroke, the ratchet mechanism will release the handles and the hand tool will spring open. See Figure 1.

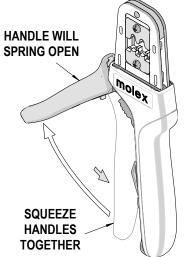



Figure 1

Crimping Terminals


- 1. Select the desired terminal from the chart, and install the proper locator (See chart above and Locator Installation on page 5).
- 2. Make sure the center of the locator is in the down position. With the locator attached, push the locator button on the back of the hand tool to bring the locator forward through the tooling. See Figure 2.
- 3. While holding in the locator button, load the terminal into the proper nest opening in the locator, based on the wire gauge or terminal type markings on the hand tooling. See Figure 3.

UNCONTROLLED COPY Doc No: ATS-638191300 Release Date: 01-22-08 Page 4 of 9

Revision: G Revision Date: 05-05-16

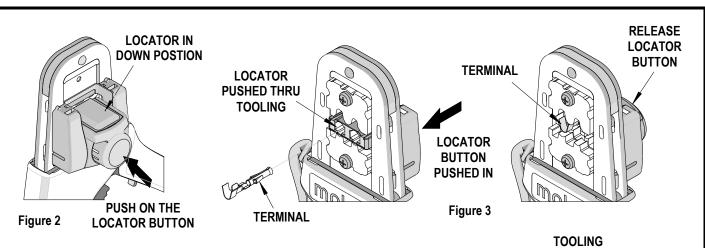


- 4. Release the locator button, allowing the locator to return to the crimping position.
- 5. Close the tool handle until the first ratchet position engages. See Figure 4.
- 6. Insert the properly stripped wire through the terminal and against the wire stop. See Figure 5.
- 7. Crimp the terminal by squeezing the tool handles until the ratchet mechanism cycle has been completed. Release the handles to open the jaws.

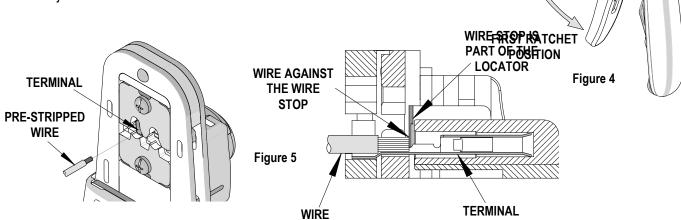

Note: The tamper proof ratchet action will not release the tool until it has been fully closed.

- 8. Remove the crimped terminal from the terminal locator by pulling on the wire.
- 9. Visually inspect the crimped terminal for proper crimp location.
- 10. On some large O.D. wires, it may not be possible to insert the wire with the tool partially closed. Those wires should be inserted with the hand tool in the open position. Insert the wire above the terminal in the punch and against the wire stop then close the tool. See Figure 6.

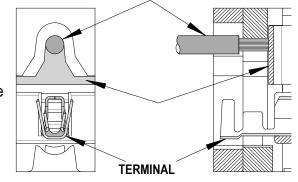

PARTIALLY CLOSED

Molex

PARTIALLY

CLOSE HANDLE


OPEN

POSITION

Doc No: ATS-638191300 Revision: G Release Date: 01-22-08 Revision Date: 05-05-16

Locator Replacement

See the parts list on the last page of this document for the proper locator order number. Follow the steps below to replace the locator.

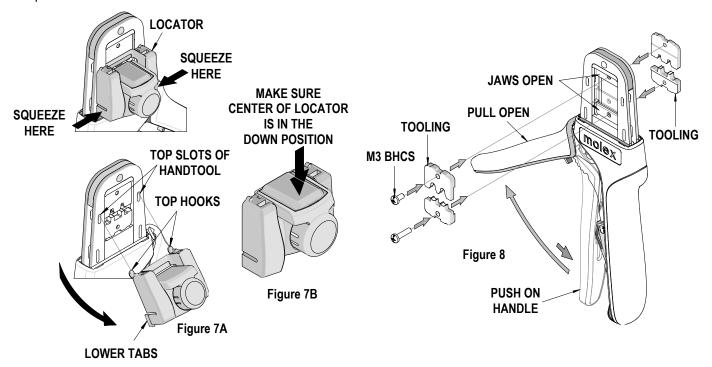


- 1. Open the crimp hand tool.
- 2. Squeeze gently on the lower area shown in Figure 7A with your thumb and index finger. The lower tabs of the locator should disengage from the hand tool.
- 3. Lift and pull away from the hand tool. The top locator hooks should slip out of the top slots easily. See Figure 7A.
- 4. To reinstall the new locator, make sure the hand tool is in the open position.
- 5. Press the red insert down as far as it will go as shown in Figure 7B.
- 6. Holding onto the lower part of the locator with your thumb and index finger, insert the locator top hooks (2) into the hand tool top slots.
- 7. Rotate the locator down and press the lower tabs into the two bottom slots of the hand tool. To secure the locator into place, the lower tabs must snap into place on the hand tool frame.

Right or Left Hand Operation

This hand tool has an added feature that can be converted from a right handed application to a left handed application. It is necessary to reverse the tooling along with the locator if using the left handed application. Follow the steps below:

- 1. The locator must be removed before reversing the tooling.
- 2. Remove the M3 screw that holds the upper tooling.

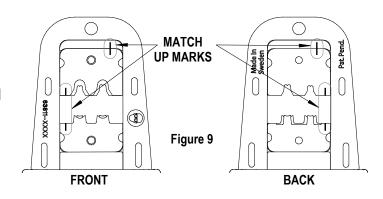

Doc No: ATS-638191300 Release Date: 01-22-08 **UNCONTROLLED COPY** Page 6 of 9 Revision: G Revision Date: 05-05-16

- 3. Flip the upper tooling to the opposite side and replace the M3 screw. Make sure the small markings on the front and back of the hand tool frame match up and are on the outside of the hand tool frame. See Figure 8 and 9.
- 4. Reverse the lower tooling and tighten the M3 screw. Be sure the small markings line up.
- 5. Reinstall the locator by following the Instructions in the locator replacement section.


Maintenance

It is recommended that each operator of the tool be made aware of, and responsible for, the following maintenance steps:

- 1. Remove dust, moisture, and other contaminants with a clean brush, or soft, lint free cloth.
- 2. Do not use any abrasive materials that could damage the tool.
- 3. Make certain all pins; pivot points and bearing surfaces are protected with a thin coat of high quality machine oil. Do not oil excessively. The tool was engineered for durability but like any other equipment it needs cleaning and lubrication for a maximum service life of trouble free crimping. Light oil (such as 30 weight automotive oil) used at the oil points, every 5,000 crimps or 3 months, will significantly enhance the tool life.
- 4. Wipe excess oil from hand tool, particularly from crimping area. Oil transferred from the crimping area onto certain terminations may affect the electrical characteristics of an application.
- 5. When tool is not in use, keep the handles closed to prevent objects from becoming lodged in the crimping dies, and store the tool in a clean, dry area.



Should this tool ever become stuck or jammed in a partially closed position, **Do not** force the handles open or closed. The tool will open easily by pressing up on the ratchet release lever in the movable handle. See Figure 11.

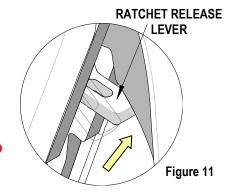

LUBRICATION POINTS

(BOTH SIDES) LIGHT OIL

(EVERY 3 MONTHS OR


5,000 CRIMPS)

Figure 10

How to Adjust Tool Preload (See Figure 12)

This hand tool is factory preset to 25-45 pounds. preload. It may be necessary over the life of the tool to adjust tool handle preload force. Listed below are the steps required to adjust the crimping force of the hand tool to obtain proper crimp conditions:

 Hold the hand tool in the palm of your hand as shown in Figure 12. Using the index finger squeeze the link towards the top of the hand tool frame. This will release the preload adjustment wheel.

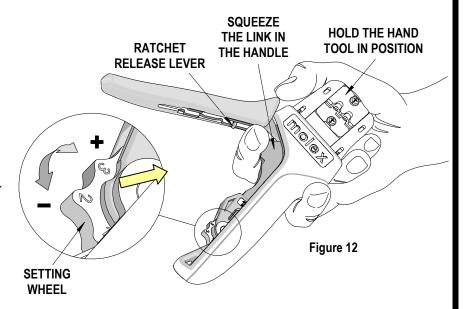

Doc No: ATS-638191300 Release Date: 01-22-08 Revision: G Revision Date: 05-05-16

UNCONTROLLED COPY

Page 7 of 9

- 2. Rotate the setting wheel counter-clockwise (CCW) to increase handle force. The numbers will display higher. To decrease handle force, rotate the setting wheel clockwise (CW).
- 3. Release the link to lock the setting wheel in place.
- 4. Check the crimp specifications or conduct a pull test after tool handle preload force is adjusted.

Warranty

This tool is for electrical terminal crimping purposes only. This tool is made of the best quality materials. All vital components are long life tested. All tools are warranted to be free of manufacturing defects for a period of 30 days. Should such a defect occur, we will repair or exchange the tool free of charge. This repair or exchange will not be applicable to altered, misused, or damaged tools. This tool is designed for hand use only. Any clamping, fixturing, or use of handle extensions voids this warranty.

CAUTION: Molex crimp specifications are valid only when used with Molex terminals and tooling.

CAUTIONS:

- 1. Manually powered hand tools are intended for low volume or field repair. This tool is NOT intended for production use. Repetitive use of this tool should be avoided.
- 2. Insulated rubber handles are not protection against electrical shock.
- 3. Wear eye protection at all times.
- 4. Use only the Molex terminals specified for crimping with this tool.

Certification

Molex does not certify or re-certify hand tools but rather supplies the following guidelines for customers to re-certify hand tools.

- This tool is qualified to pull force only. To re-certify, crimp a terminal to a wire, which has been stripped 12.7mm (1/2") long, so there is no crimping of the insulation. Pull the terminal and wire at a rate no faster than 25mm (1.00") per minute. See the Molex web site for the Quality Crimp Handbook for more information on pull testing.
- % If the tool does not meet minimum pull force values, handle preload should be increased and the pull test rerun, (See How to Adjust Preload).
- When the hand tool is no longer capable of achieving minimum pull force, it should be taken out of service and replaced.


Doc No: ATS-638191300 Release Date: 01-22-08 **UNCONTROLLED COPY** Page 8 of 9

Revision Date: 05-05-16

Revision: G

PARTS LIST

Item Number	Order Number	Description	Quantity
REF	63819-1300	Hand Crimp Tool	Figure 13
1	63819-1375	Locator Assembly	1
2	63810-0104	Spring, Return	1
3	63810-0105	Spring, Ratchet	1

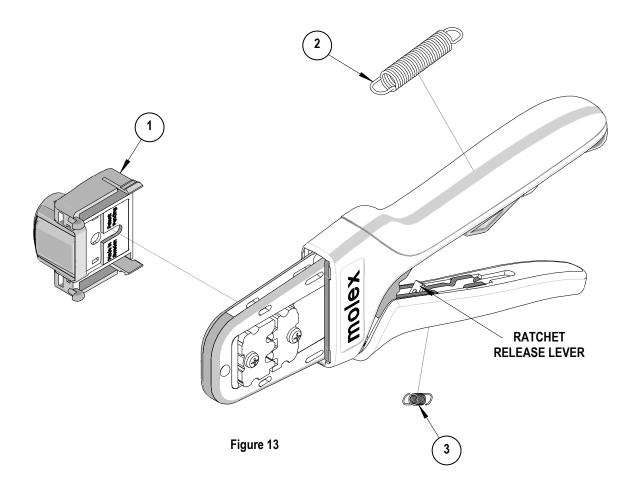

Visit our Web site at http://www.molex.com

Doc No: ATS-638191300 Revision: G Release Date: 01-22-08 Revision Date: 05-05-16