




US32-24MM-1/2"-SS

Ruland US32-24MM-1/2"-SS, 24mm x 1/2" Single Universal Joint, Friction Bearing, Stainless Steel, 1.995" (50.7mm) OD, 5.500" (139.7mm) Length



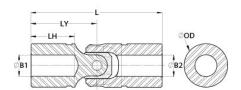

Description

Ruland US32-24MM-1/2"-SS is a single cardan friction bearing universal joint with 24mm x 0.5000" bores, 1.995" (50.7mm) OD, and 5.500" (139.7mm) length. It is ideal for applications with space constraints and has higher torque capacity than equivalently sized double universal joints. This plain bearing universal joint is comprised of pins and blocks that are precision machined, selectively heat treated, and ground for high strength, accuracy, and wear resistance. The combination of these components with precision ground and hardened yoke ears allow for a longer lifespan, increased performance in demanding applications, and greater angular misalignment of up to 45° when compared to commodity style single universal joints. US32-24MM-1/2"-SS is made from high grade stainless steel for increased corrosion resistance. It can be combined with boot UBOOT32/51-NI-KIT to protect the joint from unwanted contaminants such as dust or water and self lubricate reducing maintenance time. This single cardan universal joint is manufactured in the USA by Belden Universal for strict control of processes.

Product Specifications

24 mm	Small Bore (B2)	0.5000 in
1.700 in (43.2 mm)	B2 Max Shaft Penetration	1.700 in (43.2 mm)
1.995 in (50.7 mm)	Bore Tolerance	+0.0010 in / -0.0000 in (+0.025 mm / -0.000 mm)
5.500 in (139.7 mm)	Yoke Length (LY)	2.750 in (69.9 mm)
1.700 in (43.2 mm)	Peak Torque	15,600 in-lb (1,762.6 Nm)
3,120 in-lb (352.5 Nm)	Max Operating Angle	45°
Yokes: 303 Stainless Steel Pins and Blocks: 416 Stainless Steel	Manufacturer	Belden Universal
USA	Recommended Lubricant	LUBRIPLATE No. 1200-2
UBOOT32/51-NI-KIT	UPC	63452933402
8483.60.4000	UNSPC	25173810
Performance ratings are for guidance only. The user must determine suitability for a particular application.		
·	· ·	tallic), known to the State of Californi
	·	to cause cancer. For more information go to <u>www.P65Warnings.ca.gov</u>