



May.1.2023 Copyright 2023 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

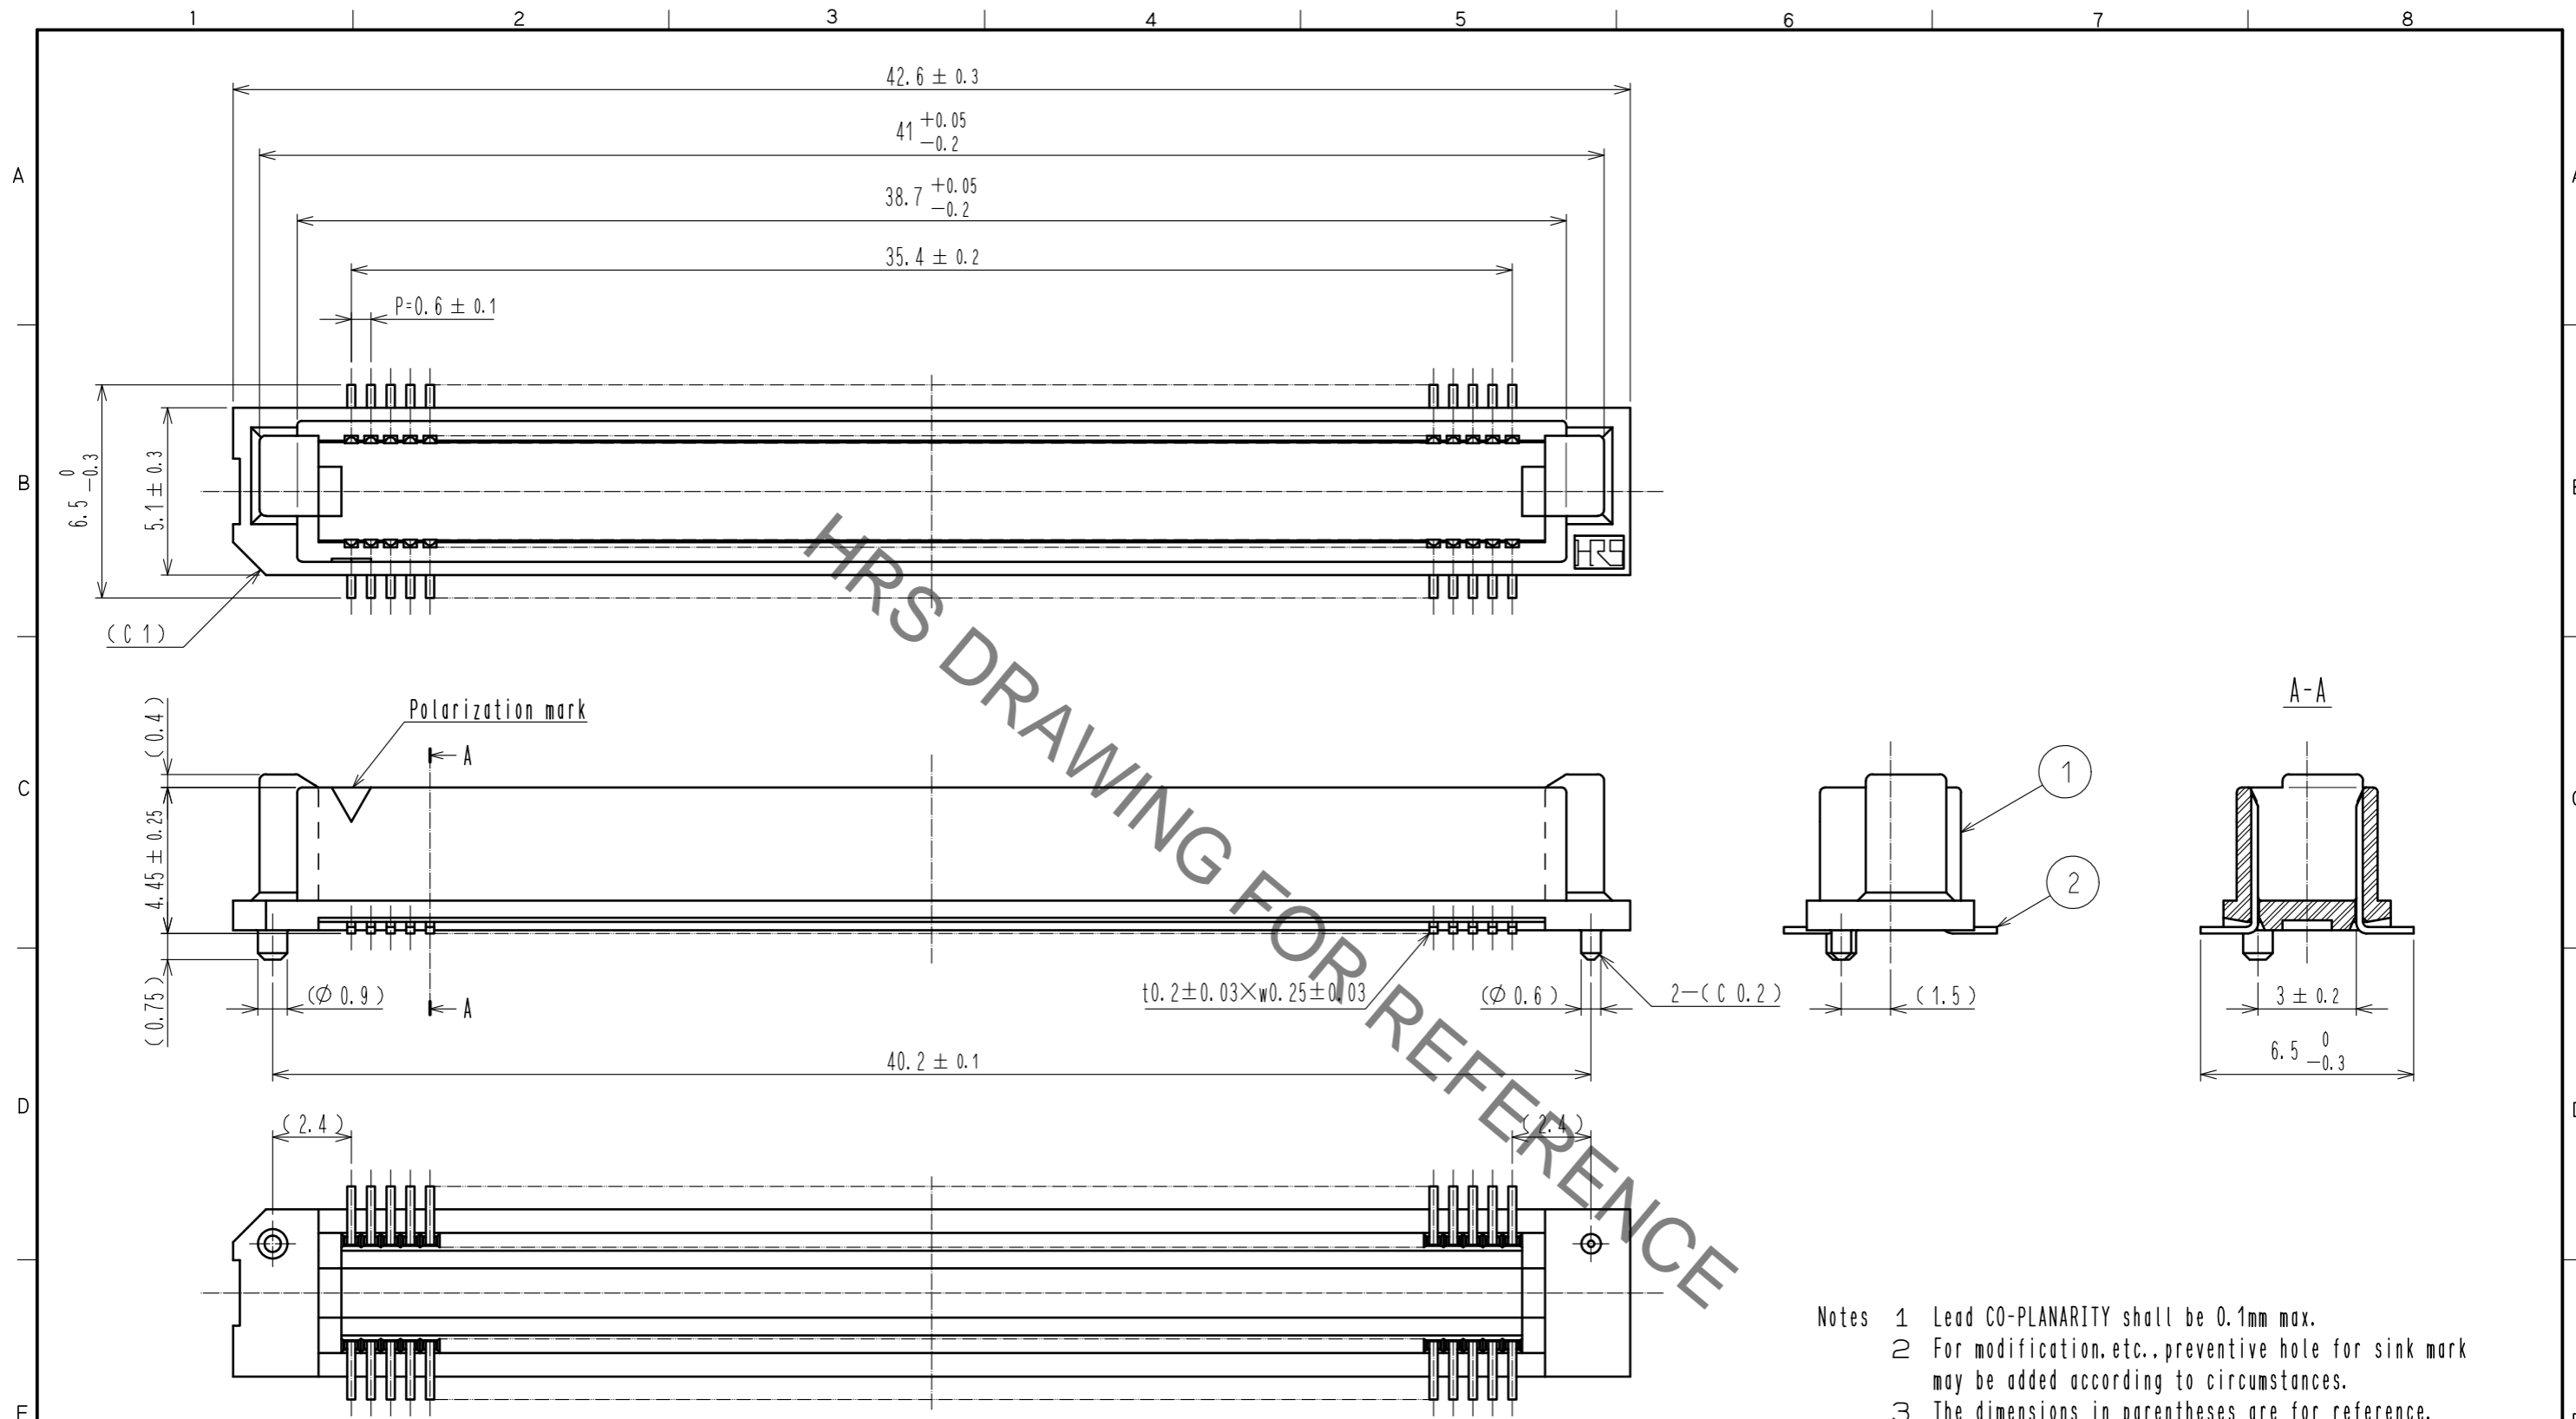

- Notes
- 1 Lead CO-PLANARITY shall be 0.1mm max.
 - 2 For modification, etc., preventive hole for sink mark may be added according to circumstances.
 - 3 The dimensions in parentheses are for reference.

Recommended land pattern dimension of PCB (mounting side) (2:1)

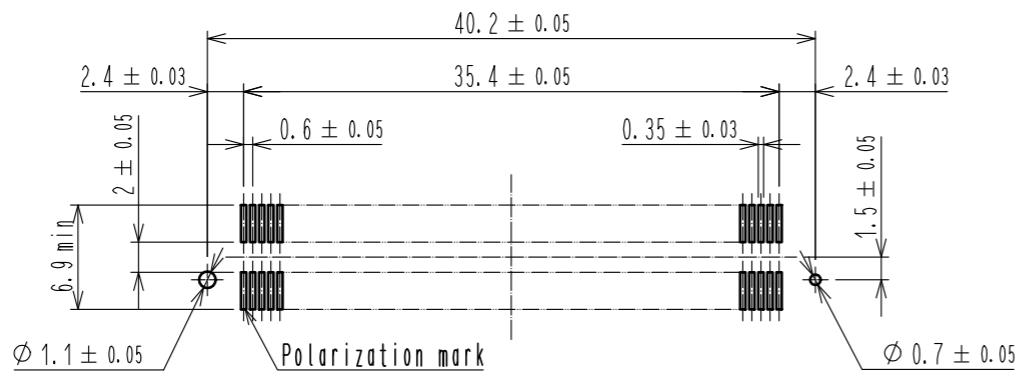

1	PPS	Light brown (UL94V-0)	2	PHOSPHOR BRONZE	Contact area : Gold 0.1μm min. Lead area : Gold flash Under plating : Nickel 0.5μm min.
NO.	MATERIAL	FINISH . REMARKS	NO.	MATERIAL	FINISH . REMARKS
UNITS mm		SCALE 5 : 1	COUNT 1	DESCRIPTION OF REVISIONS DIS-F-00006413	DESIGNED KS. NAKAJIMA
APPROVED : HS. OKAWA		20051116	DRAWING NO. EDC-150824-71-25		
CHECKED : HS. OZAWA		20051116	PART NO. FX8C-120P-SV(71)		
DESIGNED : KY. NAKAMURA		20051116	CODE NO. CL578-0506-2-71		
DRAWN : KY. NAKAMURA		20051116	1/2		


Added precaution

May.1.2023 Copyright 2023 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.


【 Precaution 】

When a board with multiple connectors mounted is mated, the connector may be damaged or deformed.
Please divide one side of the board so only one connector is mated per board.

OK

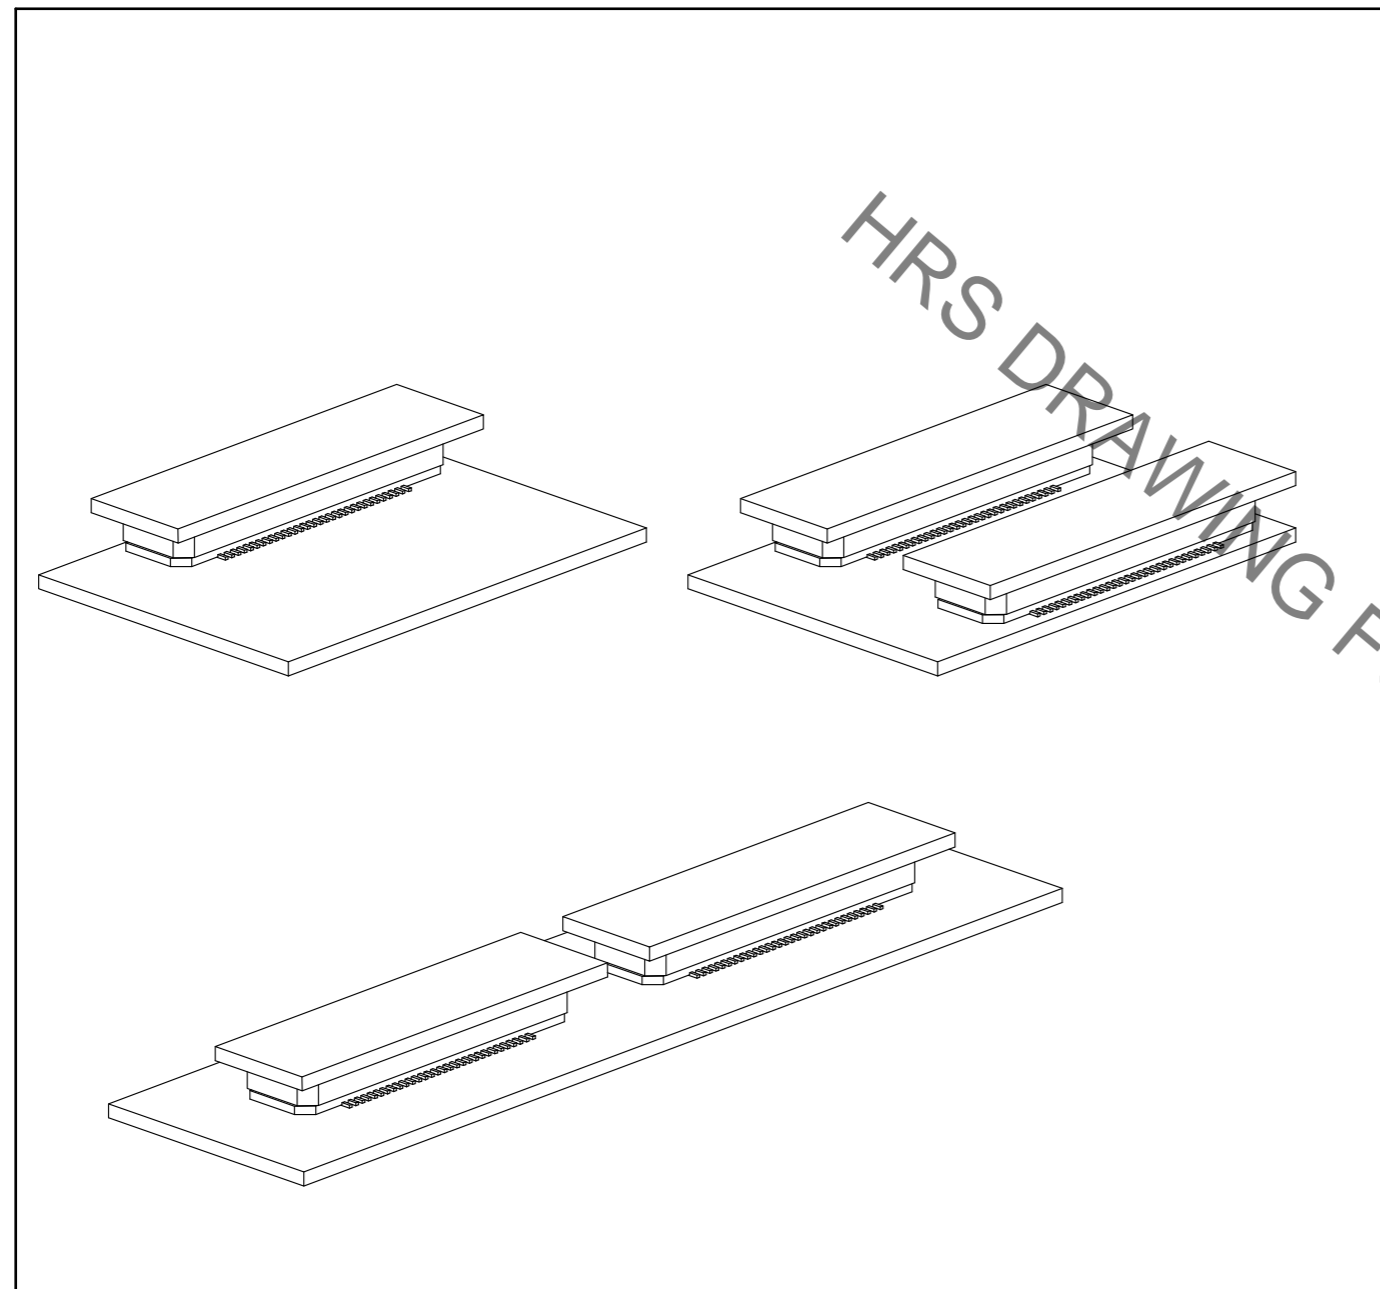

NG

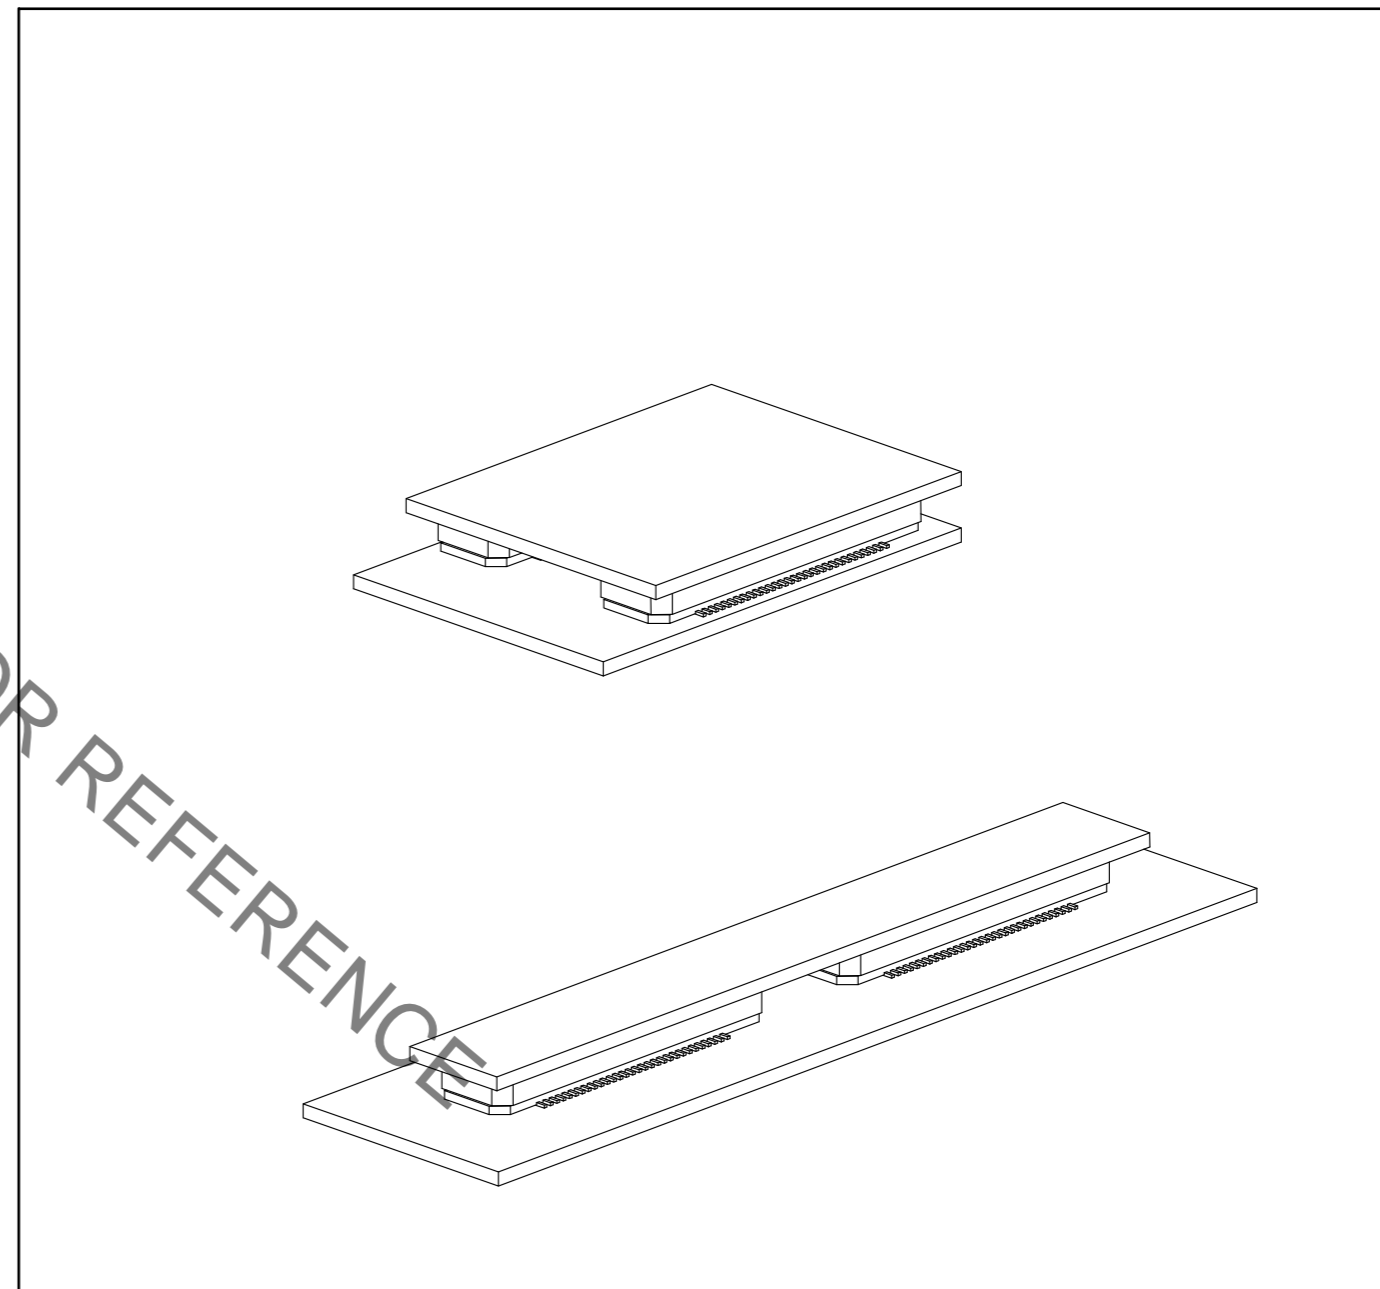

HRS DRAWING FOR REFERENCE

HRS	DRAWING NO.	EDC-150824-71-25
	PART NO.	FX8C-120P-SV(71)
	CODE NO.	CL578-0506-2-71
		2/2